



the **play inspection** company

Annual Inspection

Babergh District Council

Copdock and Washbrook Parish Council - Fen View

Fen View, Copdock,



API Associate



Unit 5, Glenmore Business Park, Blackhill Road, Poole, Dorset, BH16 6NL
t- 01202 590675 e- info@playinspections.co.uk

[www. playinspections .co.uk](http://www.playinspections.co.uk)

Inspection Scope for RPII Inspection Methodology

This document outlines the RPII scope for inspections undertaken by the Inspectors listed as Annual Inspectors on the RPII Register of Inspectors when undertaking Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine inspections.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it will be the standard that is current at the time of inspection except where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection, unless they are also explicitly listed here.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this includes public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below):

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document. It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 – Part 7) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standards (BS EN 71 series – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance will follow the requirements and recommendations of BS EN 1176.

When water play items, including spray parks, are inspected any comments concerning compliance within the inspection will refer to BS EN 1176. We have not assessed these against the requirements of BS EN 17232 (Water play equipment and features).

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

- BS EN 15312** Free access multi-sports equipment
- BS EN 14974** Skateparks
- BS EN 16630** Permanently installed outdoor fitness equipment
- BS EN 16899** Parkour equipment (plus RPII/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with these current standards, and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area (that area which is obviously part of the playground), nominally up to three metres around, the fence line if closer, or other areas as agreed.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity, wear and vandalism.

Routine visual inspections relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

All inspections are non-dismantling, non-destructive and do not include any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all reasonably accessible equipment and will assess all reasonably accessible parts above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment.

Ancillary equipment will be assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to a general safety assessment).

The owner/operator is responsible for the overall safety of the equipment and area.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of the impact attenuating properties of any surfaces; the identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection; the inspection of any equipment (or part thereof) that is beneath the playing surface (loose-fill materials may be moved to expose foundations); tightening any bolts, hinges or other fixing devices on any apparatus or equipment; assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment; assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming); where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken – the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity. This inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/or that of the inspection company. The owner/operator should always seek the advice of the manufacturer or a competent person when undertaking repairs and/or modifications to equipment.

A full copy of the Play Inspection Company Ltd. Terms & Conditions is available on our website (www.playinspections.co.uk)

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection recommendations of relevant standards Refer to relevant standards for full text	Annual Main	RPII Annual/ Post Installation Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	✓	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	✓	✓ [3]
6.1 d) Effects of weather	✓	✓
6.1 d) Presence of rot, decay or corrosion (see note 1)	✓	✓ [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	✓	✓ [4]
6.1 d) Excavation or dismantling/additional measures	✓	✗
6.2.1 Assessment of glass reinforced plastics (see note 5)	✓	✓ [5]
6.2.1 Inspection of one post equipment (see note 1)	✓	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	✓	✗

NB: The clause numbers in table 1 are taken from BS EN 1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall Annual Main Inspection as detailed in the relevant standards.

[1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.

[2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.

[3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.

[4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance.

[5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.

Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity					
			Severity>>					
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
			Very Low	Low	Moderate	High	Very High	
			1	2	3	4	5	
			No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality	
			Severity>>					
<p>Note 1: The total risk scores included within our reports are a multiplication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).</p> <p>Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.</p>								

Equipment has been assessed to the following standards where relevant:

- BS EN 1176 Parts 1-11 (Playground equipment and surfacing)
- BS EN 14974 (Facilities for users of roller sports equipment)
- BS EN 15312 (Free access multi-sports equipment)
- BS EN 16899 (Parkour Equipment)
- BS EN 16630 (Outdoor Fitness Equipment).

Copdock and Washbrook Parish Council - Fen View

Inspection Ref: 2983758

Site Ref: 119913

Inspected: 16-February-2026 - 15:00 by James Law (RPII Annual Inspector)

Risk Assessment: 10 Low Risk

**Location:**

The site is located in an area of public open space and is overlooked by a number of properties in the local community.

Disabled Access:

Some accessible features - The area includes limited accessible elements; however, aspects of the layout, surfacing, or equipment may present barriers to use for some people with disabilities without reasonable adjustments or assistance.

i 10 - Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 3



Finding 1

There is no physical barrier between the road and the play area - Ensure a full and sufficient risk assessment is in place and review regularly

Finding 2

There is weed / vegetation growth within the surface - Remove weed / vegetation growth

Finding 3

There is a damaged and unsecured domestic football goal present on site - Remove

i 4 - Very Low Risk

Item: Sign
Manufacturer: Not Identified
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Litter Bin
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

The post is loose in its foundations - Reinstall item to secure

i 6 - Low Risk

Item: Bench
Manufacturer: Not Identified
Surface Type: Concrete
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding - Treat affected areas and repaint

i 8 - Low Risk

Item: Rope Bridge
Manufacturer: Not Identified
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 3

Finding 1

The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding - Treat affected areas and repaint

Finding 2

The connecting links are in excess of 8.6mm and less than 12mm and fail the requirements of BS EN 1176 Part 1; clause 4.2.13, Chains - Monitor use and replace with compliant links at the next maintenance cycle

Finding 3

There are missing inserts creating finger entrapment/s in the framework and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers - Replace the missing inserts to remove the entrapment

i 6 - Low Risk

Item: Rubber Steps
Manufacturer: Not Identified
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

The step between the items is quite large and users may not be able to complete the step without touching ground, the items could therefore be considered to be within the falling space of each other, however the intention of the play activity continuity is easily apparent and foreseeable to the user - Monitor - No action given the risk assessment

i 6 - Low Risk

Item: Chain Traverse
Manufacturer: Not Identified
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There is/are bolt cap covers missing or damaged on the item - Replace missing or damaged bolt cap covers

i 8 - Low Risk

Item: Rotating Beam
Manufacturer: Not Identified
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: 2 Bay (2 Flat, 2 Cradle)
Manufacturer: Not Identified
Surface Type: Bonded Rubber Mulch
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 5

Finding 1

There is moderate damage to the surface - Repair the damaged areas of surfacing

Finding 2

There is algae or moss on the surface of the seats - Clean and treat appropriately

Finding 3

The bushes are showing signs of wear - Monitor for any further deterioration and replace as required

Finding 4

BS EN 1176 Part 2: Annex A makes a recommendation that fences or enclosures should be 1.50m from the edges of the swing seat to the sides, and subject to risk assessment, from the edge of the impact area. This is however, a low risk finding and no remedial action is recommended. - Monitor - No action given the risk assessment

Finding 5

There is algae, silt or moss growth on the surface resulting in slippery conditions - Clean and treat appropriately

i 8 - Low Risk

Item: Basket Swing - Type 1
Manufacturer: Playquip
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Multi Play (Junior)
Manufacturer: Not Identified
Surface Type: Bonded Rubber Mulch
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 6

Finding 1

There are a number of dents in the slide surface - Monitor for any further deterioration and repair as required

Finding 2

There is/are finger entrapment/s in the framework and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers - Monitor - No action given the risk assessment

Finding 3

There is/are bolt cap covers missing or damaged on the item - Replace missing or damaged bolt cap covers

Finding 4

The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps - Monitor - No action given the risk assessment

Finding 5

There is or are fixings missing on the post - Replace all missing fixings

Finding 6

A number of fixing(s) have worked loose - Secure all loose fixings

i 8 - Low Risk

Item: Rope Tunnel
Manufacturer: Not Identified
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes




Total Findings: 1

Finding 1

There is/are finger entrapment/s in the frame and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers - Monitor - No action given the risk assessment

i 8 - Low Risk

Item: Wobble Board
Manufacturer: Not Identified
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

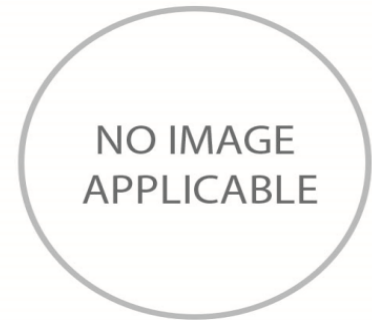

Total Findings: 2

Finding 1

The adjacent items forms a projecting obstacle / hard object within the falling space of the equipment, in contravention of the requirements of BS EN 1176 Part 1 - Monitor - No action given the risk assessment

Finding 2

The clearance to the underside of the wobble board is less than 400mm and fails the requirements of BS EN 1176 Part 1 - Monitor - No action given the risk assessment

i 9 - Low Risk

Item: Rotating Net
Manufacturer: Not Identified
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 2

Finding 1

The paint is flaking off the metalwork - Rub down and re-paint

Finding 2

There is / are steep gradients along the edges of the synthetic surface that may cause users to trip or roll ankles - Build up surrounding surface levels to remove

i 6 - Low Risk

Item: Chain Traverse & Swinging Steps
Manufacturer: Not Identified
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Free Standing Slide
Manufacturer: Not Identified
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 6

Finding 1

There are a number of dents in the slide surface - Monitor for any further deterioration and repair as required

Finding 2

The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps - Monitor - No action given the risk assessment

Finding 3

There is/are finger entrapment/s in the framework and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers - Monitor - No action given the risk assessment

Finding 4

There is / are toggle entrapment/s present in contravention of the recommendations set out in BS EN 1176 Part 1 - Monitor - No action given the risk assessment

Finding 5

The paint is flaking off the metalwork - Rub down and re-paint

Finding 6

There are projecting bolt thread(s) present - Remove excess thread length and deburr or provide cap

i 4 - Very Low Risk

Item: Activity Trail
Manufacturer: Not Identified
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Roundabout
Manufacturer: Not Identified
Surface Type: Bonded Rubber Mulch
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 3



Finding 1

The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 for head and neck entrapment in the framework - Monitor - No action given the risk assessment

Finding 2

The paint is flaking off the metalwork - Rub down and re-paint

Finding 3

The bearing is worn / damaged and the item is not operating correctly - Repair / replace

Findings information

i 0 - Risk Assessment not Undertaken (Finding 1)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: N - Risk Assessment not Undertaken
Surface: N/A



Finding: There is no physical barrier between the road and the play area

Action: Ensure a full and sufficient risk assessment is in place and review regularly

i 6 - Low Risk (Finding 2)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is weed / vegetation growth within the surface

Action: Remove weed / vegetation growth

i 10 - Low Risk (Finding 3)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is a damaged and unsecured domestic football goal present on site

Action: Remove

i 8 - Low Risk (Finding 1)

Item: Ancillary Items - Litter Bin
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: The post is loose in its foundations

Action: Reinstall item to secure

i 6 - Low Risk (Finding 1)

Item: Ancillary Items - Bench
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Concrete



Finding: The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding

Action: Treat affected areas and repaint

i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Rope Bridge
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding

Action: Treat affected areas and repaint

i 5 - Very Low Risk (Finding 2)

Item: Activity Equipment - Rope Bridge
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: The connecting links are in excess of 8.6mm and less than 12mm and fail the requirements of BS EN 1176 Part 1; clause 4.2.13, Chains

Action: Monitor use and replace with compliant links at the next maintenance cycle

i 8 - Low Risk (Finding 3)

Item: Activity Equipment - Rope Bridge
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There are missing inserts creating finger entrapment/s in the framework and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers

Action: Replace the missing inserts to remove the entrapment

i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Rubber Steps
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The step between the items is quite large and users may not be able to complete the step without touching ground, the items could therefore be considered to be within the falling space of each other, however the intention of the play activity continuity is easily apparent and foreseeable to the user

Action: Monitor - No action given the risk assessment

i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Chain Traverse
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There is/are bolt cap covers missing or damaged on the item

Action: Replace missing or damaged bolt cap covers

i 8 - Low Risk (Finding 1)

Item: Swings - 2 Bay (2 Flat, 2 Cradle)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: There is moderate damage to the surface

Action: Repair the damaged areas of surfacing

i 6 - Low Risk (Finding 2)

Item: Swings - 2 Bay (2 Flat, 2 Cradle)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: There is algae or moss on the surface of the seats

Action: Clean and treat appropriately

i 4 - Very Low Risk (Finding 3)

Item: Swings - 2 Bay (2 Flat, 2 Cradle)
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Bonded Rubber Mulch



Finding: The bushes are showing signs of wear

Action: Monitor for any further deterioration and replace as required

i 6 - Low Risk (Finding 4)

Item: Swings - 2 Bay (2 Flat, 2 Cradle)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: BS EN 1176 Part 2: Annex A makes a recommendation that fences or enclosures should be 1.50m from the edges of the swing seat to the sides, and subject to risk assessment, from the edge of the impact area. This is however, a low risk finding and no remedial action is recommended.

Action: Monitor - No action given the risk assessment

i 6 - Low Risk (Finding 5)

Item: Swings - 2 Bay (2 Flat, 2 Cradle)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: There is algae, silt or moss growth on the surface resulting in slippery conditions

Action: Clean and treat appropriately

i 4 - Very Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Bonded Rubber Mulch



Finding: There are a number of dents in the slide surface

Action: Monitor for any further deterioration and repair as required

i 8 - Low Risk (Finding 2)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: There is/are finger entrapment/s in the framework and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers

Action: Monitor - No action given the risk assessment

i 4 - Very Low Risk (Finding 3)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Bonded Rubber Mulch



Finding: There is/are bolt cap covers missing or damaged on the item

Action: Replace missing or damaged bolt cap covers

i 5 - Very Low Risk (Finding 4)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Bonded Rubber Mulch



Finding: The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps

Action: Monitor - No action given the risk assessment

i 6 - Low Risk (Finding 5)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: There is or are fixings missing on the post

Action: Replace all missing fixings

i 6 - Low Risk (Finding 6)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

i 8 - Low Risk (Finding 1)

Item: Activity Equipment - Rope Tunnel
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There is/are finger entrapment/s in the frame and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers

Action: Monitor - No action given the risk assessment

i 5 - Very Low Risk (Finding 1)

Item: Activity Equipment - Wobble Board
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: The adjacent items forms a projecting obstacle / hard object within the falling space of the equipment, in contravention of the requirements of BS EN 1176 Part 1

Action: Monitor - No action given the risk assessment

i 8 - Low Risk (Finding 2)

Item: Activity Equipment - Wobble Board
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The clearance to the underside of the wobble board is less than 400mm and fails the requirements of BS EN 1176 Part 1

Action: Monitor - No action given the risk assessment

i 6 - Low Risk (Finding 1)

Item: Rotor Play - Rotating Net
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The paint is flaking off the metalwork

Action: Rub down and re-paint

i 9 - Low Risk (Finding 2)

Item: Rotor Play - Rotating Net
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There is / are steep gradients along the edges of the synthetic surface that may cause users to trip or roll ankles

Action: Build up surrounding surface levels to remove

i 4 - Very Low Risk (Finding 1)

Item: Other - Free Standing Slide
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: There are a number of dents in the slide surface

Action: Monitor for any further deterioration and repair as required

i 5 - Very Low Risk (Finding 2)

Item: Other - Free Standing Slide
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps

Action: Monitor - No action given the risk assessment

i 5 - Very Low Risk (Finding 3)

Item: Other - Free Standing Slide
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: There is/are finger entrapment/s in the framework and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers

Action: Monitor - No action given the risk assessment

i 5 - Very Low Risk (Finding 4)

Item: Other - Free Standing Slide
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: There is / are toggle entrapment/s present in contravention of the recommendations set out in BS EN 1176 Part 1

Action: Monitor - No action given the risk assessment

i 6 - Low Risk (Finding 5)

Item: Other - Free Standing Slide
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The paint is flaking off the metalwork

Action: Rub down and re-paint

i 8 - Low Risk (Finding 6)

Item: Other - Free Standing Slide
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There are projecting bolt thread(s) present

Action: Remove excess thread length and deburr or provide cap

i 5 - Very Low Risk (Finding 1)

Item: Rotor Play - Roundabout
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Bonded Rubber Mulch



Finding: The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 for head and neck entrapment in the framework

Action: Monitor - No action given the risk assessment

i 6 - Low Risk (Finding 2)

Item: Rotor Play - Roundabout
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: The paint is flaking off the metalwork

Action: Rub down and re-paint

i 8 - Low Risk (Finding 3)

Item: Rotor Play - Roundabout
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: The bearing is worn / damaged and the item is not operating correctly

Action: Repair / replace